
Building Research Establishment Digest



LANUYERSITY OF NAIROP Library

Prevention of decay in external joinery

An increasing number of reports of 'wet rot' in external joinery, particularly in new houses, suggests that the factors responsible are not as widely understood as they should be. This Digest examines the causes of decay and makes recommendations as to its prevention.

Incidence

Type and symptoms

Causes and prevention

Decay in exterior windows and doors has always occurred sporadically, but the number of reported cases of decay has increased appreciably over the past few years and is found even in joinery complying with current Codes of Practice and Specifications. Window joinery in newly built houses has given most cause for complaint; decay has sometimes become a serious problem within five or six years from the time of construction. Usually, decay has been noted earlier in the wetter, western areas of the British Isles though it has by no means been confined to these regions.

While decay may occur anywhere in opening lights and in frames permanently in contact with brickwork or blockwork, it is particularly marked in ground floor windows, especially kitchen and bathroom windows. The lower parts of these windows, ie the cills, the bases of jambs and mullions and the lower rails of opening lights, are particularly susceptible.

Almost invariably decay is of the wet rot type. This means that the fungi responsible, unlike the dry rot fungus, will not spread the rot to other woodwork in the building. Discoloration of the paintwork and 'cupping', or softening of the underlying wood, are the usual first symptoms of decay. Later, cross-cracking and dark discoloration of the wood itself may be observed. Sometimes in the later stages the wood becomes soft and stringy. There is no evidence of Baltic redwood having been infected prior to manufacture by the fungi responsible for wet rot.

Decay is caused by timber of low natural resistance becoming sufficiently moist to allow wood-destroying fungi to grow. Prevention of decay therefore depends on the selection of timber which is either naturally resistant to decay or which is otherwise protected by preservative treatment. Only heartwood has natural resistance to decay; sapwood * *must* be excluded where preservative treatment is not used.

^{*} Sapwood cannot economically be excluded from joinery grade redwood.

Moisture control

Timber and its selection

Add. Pamph 7 A 1982/6

Preservative treatments

Irrespective of the species of timber employed, adequate seasoning to remove moisture is essential before manufacture as joinery. A low moisture content restricts dimensional changes, permits satisfactory painting and contributes generally towards decay prevention. After seasoning, further access of moisture should be restricted :

by good design and careful fabrication of the joinery itself, particularly of the joints;

by storage indoors or raised clear of the ground and covered with waterproof sheets to protect the woodwork from exposure to the weather prior to final installation and painting;

by good detailing at the window/wall joint;

by thorough painting and regular maintenance;

by prompt attention to any necessary repairs.

Timbers for mass production joinery are chosen mainly because they are inexpensive and easily machined, not because they are particularly resistant to decay.

Baltic redwood (also known as red or yellow deal, red pine or fir) is the softwood most used for exterior joinery; its heartwood is more resistant to decay than its sapwood. The heartwood of Douglas fir is also used.

English oak is the traditional hardwood for exterior joinery, especially cills, in which greater resistance to decay is an asset. The hardwoods teak, utile, gurjun and agba have also proved acceptable. All these should be specified by name; merely to specify 'hardwood' can lead to the use of unsuitable timbers such as abura, beech, obeche and ramin (all with poor resistance to decay). The inclusion of perishable sapwood of an otherwise decay-resistant timber can be avoided by specifying 'Heartwood only'.

Suitable timber species and their properties are set out in Table 1 (on page 7), extracted from CP 153: Part 2: 1970.

As Baltic redwood predominates in window joinery in the United Kingdom, the remarks which follow apply mainly to this timber. However, the principles of prevention and treatment of timber decay do not vary much between any of the different species used.

Care in design, construction, handling and maintenance can reduce but not eliminate the risk of decay. The obvious but often too costly remedy is to use naturally durable timber, excluding all sapwood. Alternatively, the risk of decay can be eliminated by adequate preservative treatment.

Recommended preservative treatments include :

Vacuum/pressure impregnation with water-borne preservative Complete penetration of the sapwood of Baltic redwood can be achieved by this method. Treatment with an aqueous solution and the subsequent redrying that is necessary, however, cause the wood to swell and then to shrink; this can result in some raising of the grain and a risk of distortion.

Double-vacuum treatment with organic-solvent type preservative The degree of treatment obtained can be controlled by varying the treating cycle used and it is possible to ensure that the net retention of the relatively high-cost preservative is adequate but not excessive. Complete penetration of sapwood is not usually obtained, but the average absorption and penetration achieved is about twice that from immersion treatment below. Diffusion treatment This is carried out at the sawmill; after processing, seasoned treated timber can be supplied to the joinery manufacturer already penetrated throughout with a water-soluble preservative. This stock can then be converted and assembled in exactly the same way as untreated wood. Because the preservative is water-soluble, there is a risk that some may be leached out if the joinery is exposed to rain for months without paint or other protection.

Immersion treatment with organic-solvent type preservative Machined components or assembled units are submerged in a tank of preservative for three minutes. This provides satisfactory protection even though sapwood penetration is incomplete. Preservatives used for immersion, and for double-vacuum treatment, often contain water repellents: these improve the dimensional stability of the wood and hence benefit the performance of the joinery.

For further information on preservative treatment see PRL Technical Note 24, *Preservative Treatments for External Softwood Joinery Timbers*; this includes a list of the commercial processes and preservatives suitable for the treatment of external joinery.

Entry of water is most likely to occur at joints. Some modern joints loosen more easily than the old-style mortice-and-tenon joints with wedged tenons, and are therefore more vulnerable to water penetration. Joints are usually made with the grain of one member at right angles to that of another. Quite small fluctuations in moisture content stress these joints severely and once cross-grain movements begin, more water can enter and threaten decay.

The animal and casein glues permitted by some joinery specifications are likely to fail in persistently moist conditions. When this happens the joints in doors and opening sashes are less able to resist sudden stresses; the joints loosen, the paint film is broken, and penetration by moisture follows. The modern, synthetic resin glues are preferred because of their greater resistance to moisture. (See Forest Products Research Bulletin 38, *The efficiency of adhesives for wood*.)

The sectional sizes of timber scantlings accepted for windows have become smaller in recent years. It is bad practice to employ flimsy sections in window joinery, particularly where weather conditions are severe, as in some parts of Scotland. Such sections are prone to distort, permitting ingress of moisture, and they may not provide adequate space for the rebate. In opening lights the strength may be insufficient to prevent racking and consequent water penetration at the joints.


Window designs with horizontal surfaces which do not effectively shed water, still more those that actually entrap it, should be avoided. This applies both to rain-water on the outside of the window and to condensation on the inside.

The present-day omission of condensation channels and adequate means of drainage from them is to be deplored. Often water stands on the sill against the bottom of the frame and seeps into the joint between the two.

Cills present problems because they require timber of larger dimensions, and hence of greater cost, and also because they tend to present a higher decay risk. Whilst decay risk can be met by using more durable timber, increased cost is involved even if such timber is restricted to the cill alone. The current trend is to reduce costs by building up the cill from two smaller dimension timbers; the increased complexity of the two-piece unit calls for greater care in design and manufacture. However, even when Baltic redwood is used, a properly designed jointed cill effectively glued with suitable adhesives and preservative treated as necessary should give adequate service.

Design and fabrication of joinery

Fig 1 Complexity of joint design in a modern frame and cill. Result—joints expose a large surface area to risk of moisture penetration and facilitate decay

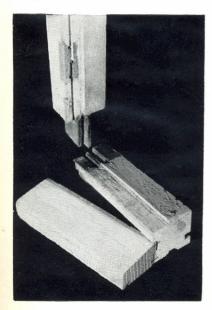

Weather protection before installation

The window/wall joint

External and internal climates

Fig 2

Outer glazing bead nailed—not glued or sealed. Result—free moisture penetration.


Grooves machined for outer glazing bead run right through mullion/transom joint. Result—void for collection of moisture

Joinery is often to be seen exposed to all weathers while in transit or awaiting installation on building sites. This is thoroughly bad practice. All woodwork should be fully protected from the weather and stacked clear of the ground. Pink primer may look protective but it is rarely effective in preventing penetration of moisture—moisture which may later cause trouble if trapped by relatively impermeable coats of paint.

A further contributory cause of moisture penetration, and therefore of decay, may arise from contact between window frames and wet brickwork. There is rarely any damp-proof barrier separating them, nor is it usual to protect the backs of the frames with extra paint before installation. Even when the joinery is set in the inner leaf of brickwork there is risk of dampness continuing in the frames for as long as it takes the brickwork to dry out.

The more usual practice, however, except in Scotland, is to set the frame in the outer leaf of brickwork; not only is this brickwork often permanently damp, the window itself is much more directly exposed to the weather. Clearly this practice carries the greater risk of timber decay. Thorough priming—two full coats of an aluminium based primer—is needed on all timber surfaces that are to be in contact with external walls.

The direct exposure of windows to driving rain and to rain-water run-off will depend on their regional location and position in the building, ie storey height and orientation (see Digest 127). That decay tends to be most marked in the lower, external parts of groundfloor windows is only to be expected. However, too little thought is given to the effects of internal climate on window joinery; this can be as damaging to the woodwork of single-glazed windows as the weather outside. In bathrooms and kitchens especially, temperature and humidity are often high, and in cold weather condensation on these windows is troublesome. Changed living habits and heating methods have aggravated the problem (see Digest 110). Often there is a pool of water along the lower edge above the back putty. This back putty is rarely as free from defects as that on the face, and water finds an easy entry. (The need for condensation channels at the base of the frame has already been mentioned.)

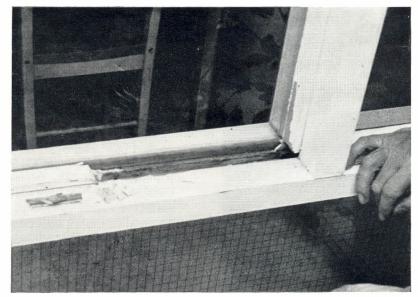

Painting and maintenance, primers (*see also* Digest 106)



Fig 3 External part of mullion/transom joint held by nail. Result—water penetrates freely once the paint film is broken. Failure through decay began after three years' service

As noted, the ability of a single coat of primer, even a good quality lead-based type, to prevent ingress of water is greatly over-estimated. 'Pink' shop primers are of variable quality and many do little more than give the joinery a uniform appearance; after quite a short exposure they become weak or powdery and unfit to take further coats of paint. Many paint failures can be traced back to poor quality primers. Thus it is most important to store joinery under cover; if this is considered impossible much better priming than usual should be specified. A water-repellent preservative plus a good quality primer, or two coats of aluminium primer, would be suitable. (Since aluminium primers will also keep moisture in, they should only be used on correctly seasoned timber, or after the moisture or solvent from preservative treatment has dried out, otherwise blistering may occur.)

Lead-based pink priming paints (BS 2521 :1966) are among the best for durability, both as part of a full paint system and if left exposed on site. They are expensive and their toxicity makes their

Fig 4 Gap left beneath tenon in joint between stile and cill or, in this case, between lower rail of main frame and base of mullion. Result—void for collection of moisture and eventual decay



Fig 5 Cupping of paintwork and putty failure associated with decay in lower rail of an opening light

Treatment of decay

Recommendations



use indoors inadvisable where children could contact them (even under further paint). Acrylic emulsion-based primers are coming into use, because they offer convenience to the joinery manufacturers. Although their water repellency may be no greater than that of many oil-based primers, they appear, on the limited evidence available, to have adequate durability before and after painting.

If a thin, weak or powdery shop coat is present, it should be sanded and a further coat of good quality primer applied. End grain and surfaces in contact with brickwork or masonry should always receive an extra coat of primer. Poor quality putty cracks or loses adhesion easily and allows water to enter at the bottom rail : all putty should be completely painted, with a slight overlap on to the glass. Hardwood cills should have the grain filled with a knifing stopper or filler (not a water-mixed type), preferably between two coats of primer.

Shellac knotting, even if it holds back resin, usually permits adhesion failure of the paint coats; an aluminium pigmented knotting is preferable, but good practice requires knots to be cut out and the cavities to be stopped.

It is important that all decayed wood should be cut out and paint stripped from adjacent areas so that damp, but not rotten, timber can be given a chance to dry out. If decay is extensive the entire window unit may have to be replaced. Wood exposed by cutting should be treated liberally with preservative, again allowed to dry, then given a coat of primer. Depending on their size, holes should be made good with stopper (see above) or primed timber, suitably shaped. Another coat of primer should be applied to the new surface, followed by undercoat and finishing coats.

1 When making use of Specifications and Codes of Practice bear in mind that their requirements may not be adequate in every circumstance to ensure satisfactory durability of the timber.

2 To ensure adequate service from Baltic redwood and other timbers of low decay resistance, insist on preservative treatment.

3 If durable hardwood is to be used specify the timber by name and insist on the exclusion of sapwood.

4 Protect joinery from the weather during delivery to the site, and on the site before installation.

5 Refuse to accept low quality shop primers. Ensure an adequate painting system.

Table 1 Timber species and properties

	1						1	1
Standard name	Sapwood	Heartwood	Resistance to impregnation with preservatives	Woodworking properties		Amount of	Paint performance	
	distinct	durability†		Resistance in cutting	Blunting effect	movement on re-wetting	in service	Remarks
Afrormosia	Yes	Very durable	Extremely resistant	Medium	Moderate	Small	Good, provided paint is not affected by oily exudations	Non-ferrous fitments necessary
Afzelia				High	Moderate	Small	*	May discolour other building materials
Iroko				Medium	Fairly severe	Small	*	
Kapur				Medium (variable)	Moderate (occasion- ally severe)	Medium	*	Non-ferrous fitments necessary
Makoré				Medium	Severe	Small	*	Non-ferrous fitments necessary
Teak					Fairly severe (variable)	Small	Good, provided paint is not affected by oily exudations	Has been known to cause discoloration of granite
Western red cedar	Yes	Durable	Resistant	Low	Mild	Small	Good	Strength relatively low. Non-ferrous fitments necessary to avoid marked discoloration of the wood under clear finishes
Agba	Moderate			Medium	Moderate	Small	Moderate, but experience is limited	Log core may contain brittleheart. Resin exudation may occur with some parcels, especially if the timber has been air-drie
European oak, American white oak, Japanese oak	Yes		Extremely resistant	Medium (variable)	Moderate (variable)	Medium	Poor	Non-ferrous fitments necessary. Occasionally disfigures other building materials
ldigbo	Moderate				Mild	Small	*	Log core may contain brittleheart. May cause staining of other building materials
Sweet chestnut	Yes			Medium	Mild	Small	*	Non-ferrous fitments necessary
Utile	!				Moderate	Medium	Good	
Douglas fir	Yes	Moderately durable	Resistant	Medium	Medium	Small	Moderate	Non-ferrous fitments advisable
African mahogany			Very resistant	Medium (variable)	Moderate (variable)	Small or medium	*	Log core may contain brittleheart
Gurjun Yang			Resistant	Medium (variable)	Moderate (occasion- ally severe)	Large	Moderate	Resin exudation occurs wi some parcels of these timbers (especially keruing
Keruing						Medium	Moderate	select material free from resin for painted work
Red meranti Red seraya	Moderate					Small	*	Log core may contain brittleheart
Sapele	Yes		Extremely resistant	Medium	Moderate	Medium	Good	
Redwood	Yes	Non-durable or perishable	Sapwood permeable Heartwood moderately resistant	Low	Mild	Medium	Good	
Western hemlock	No		Sapwood and heartwood resistant	Low	Mild	Small	Good	
Whitewood	()	1 1	· · · · · · · · · · · · · · · · · · ·		[]	[]		
American red oak	Yes		Sapwood permeable Heartwood resistant	Medium	Moderate	Medium	Poor	Non-ferrous fitments advisable
Beech	No		Permeable	Medium (variable)	Moderate (variable)	Large	Good	•
Ramin				Medium	Moderate	Large	Moderate, but experience is limited	

† The sapwood of all species is either perishable or non-durable.

* Seldom painted; there is therefore little painting experience.



Advisory centres at:

Building Research Advisory Service Building Research Station Garston, Watford WD2 7JR Telephone Garston (Herts) 76612 Telex 923220

Building Research Advisory Service Fire Research Station, Borehamwood, Hertfordshire, WD6 2BL Telephone 01-953 6177 Building Research Advisory Service Princes Risborough Laboratory Princes Risborough Aylesbury, Buckinghamshire Telephone Princes Risborough 3101

Building Research Advisory Service Birmingham Engineering and Building Centre Broad Street, Birmingham B1 2DB Telephone 021-643 8961 The Building Research Advisory Service can help you solve construction problems. Problems of every sort. From the simple ones which require only a piece of literature or an off-the-cuff answer at no charge, to more complex problems requiring investigation on site or laboratory study for which we charge on a time basis.

Anyone can use this service. There are five centres: Watford, Birmingham and Glasgow tackle most subjects, fire enquiries are dealt with at Borehamwood and timber problems are answered by Princes Risborough.

If you become an Associate Member (fee: £5 a year) you get a credit service with 10% discount, priority over non-associates and free Building Research Digests (including revisions). Contact any of the Advisory Centres below and we will send you more details about the Service and Associate membership.

Building Research Advisory Service Scottish Laboratory, Kelvin Road, East Kilbride, Glasgow G75 0RZ Telephone East Kilbride 33941

Associate Membership now £5.50 a year (including VAT)

Department of the Environment

Building Research Establishment

Prepared at Princes Risborough Laboratory, Princes Risborough, Aylesbury, Buckinghamshire. © Crown copyright 1973 **Technical enquiries** arising from this Digest should be directed to Building Research Advisory Service at the above address. Published by Her Majesty's Stationery Office and printed in England by Benham and Company Limited, Colchester. Single copies 5p each. Annual subscription inclusive of postage £1.20 to cover 18 issues. Quantity rates (excluding postage) for bulk supply of any one Digest: 25 for £1.05, 50 for £1.65, 100 for £3.

Dmd. 505892 K148